# MACI- autologous cultured chondrocytes implant
# Vericel Corporation

---

**HIGHLIGHTS OF PRESCRIBING INFORMATION**
**These highlights do not include all the information needed to use MACI safely and effectively. See full prescribing information for MACI.**

**MACI® (autologous cultured chondrocytes on porcine collagen membrane)**
**Cellular sheet for autologous implantation**
**Initial U.S. Approval: 2016**

## INDICATIONS AND USAGE

MACI® is an autologous cellularized scaffold product indicated for the repair of symptomatic, single or multiple full-thickness cartilage defects of the knee with or without bone involvement in adults. (1)

Limitations of Use

- Effectiveness of MACI in joints other than the knee has not been established.
- Safety and effectiveness of MACI in patients over the age of 55 years have not been established.

## DOSAGE AND ADMINISTRATION

**For autologous implantation only.**

- Contact Vericel at 1-800-453-6948 or www.MACI.com regarding training materials for surgical implantation of MACI. (2)
- The amount of MACI implanted depends on the size (surface area in $cm^2$) of the cartilage defect. (2.1)
- MACI should be cut to the size and shape of the defect and implanted with the cell-side down. (2.2)

## DOSAGE FORMS AND STRENGTHS

Each 3 x 5 cm cellular sheet (MACI implant) consists of autologous cultured chondrocytes on a resorbable porcine Type I/III collagen membrane, at a density of at least 500,000 cells per $cm^2$. (3)

## CONTRAINDICATIONS

- Known history of hypersensitivity to gentamicin, other aminoglycosides, or products of porcine or bovine origin. (4)
- Severe osteoarthritis of the knee. (4)
- Inflammatory arthritis, inflammatory joint disease, or uncorrected congenital blood coagulation disorders. (4)
- Prior knee surgery (within 6 months), excluding surgery to procure a biopsy or a concomitant procedure to prepare the knee for a MACI implant. (4)
- Inability to cooperate with a physician-prescribed post-surgical rehabilitation program. (4)

## WARNINGS AND PRECAUTIONS

- Malignancy: The risk of malignancy in the area of cartilage biopsy or implant is unknown. Expansion of malignant or dysplastic cells present in biopsy tissue during manufacture and subsequent implantation may be possible. (5.1)
- Transmissible infectious diseases: Because patients undergoing procedures associated with MACI are not routinely tested for transmissible infectious diseases, cartilage biopsy and MACI implant may carry risk of transmitting infectious diseases. (5.2)
- Presurgical Comorbidities: Local inflammation or active infection in the bone, joint, and surrounding soft tissue, meniscal pathology, cruciate ligament instability, and misalignment should be assessed and treated prior to or concurrent with MACI implantation. (5.3)
- Product Sterility: Final sterility test results are not available at the time of shipping. (5.4)

## ADVERSE REACTIONS

The most frequently occurring adverse reactions (≥5%) reported for MACI were arthralgia, tendonitis, back pain, joint swelling, and joint effusion. (6)

Serious adverse reactions reported for MACI were arthralgia, cartilage injury, meniscus injury, treatment failure, and osteoarthritis. (6)

**To report SUSPECTED ADVERSE REACTIONS, contact Vericel at 1-800-453-6948 or FDA at 1-800-FDA-1088 or *www.fda.gov/medwatch* for voluntary reporting of adverse reactions.**

**USE IN SPECIFIC POPULATIONS**

Pregnancy: Because MACI implantation requires invasive surgical procedures, use in pregnancy is not recommended. (8.1)

**See 17 for PATIENT COUNSELING INFORMATION.**

**Revised: 3/2026**

---

**FULL PRESCRIBING INFORMATION: CONTENTS***


**1 INDICATIONS AND USAGE**
**2 DOSAGE AND ADMINISTRATION**
2.1 Dosage
2.2 Preparation and Implantation Procedure
2.3 Postsurgical Rehabilitation
**3 DOSAGE FORMS AND STRENGTHS**
**4 CONTRAINDICATIONS**
**5 WARNINGS AND PRECAUTIONS**
5.1 Malignancy
5.2 Transmissible Infectious Diseases
5.3 Presurgical Assessment of Comorbidities
5.4 Product Sterility
**6 ADVERSE REACTIONS**
6.1 Clinical Trials Experience
6.2 Postmarketing Experience
**8 USE IN SPECIFIC POPULATIONS**
8.1 Pregnancy
8.2 Lactation
8.4 Pediatric Use
8.5 Geriatric Use
**11 DESCRIPTION**
**12 CLINICAL PHARMACOLOGY**
12.1 Mechanism of Action
12.3 Pharmacokinetics
**13 NONCLINICAL TOXICOLOGY**
13.1 Carcinogenesis, Mutagenesis, Impairment of Fertility
13.2 Animal Toxicology and/or Pharmacology
**14 CLINICAL STUDIES**
**15 REFERENCES**
**16 HOW SUPPLIED/STORAGE AND HANDLING**
**17 PATIENT COUNSELING INFORMATION**


* Sections or subsections omitted from the full prescribing information are not listed.

---

## FULL PRESCRIBING INFORMATION

### 1 INDICATIONS AND USAGE

MACI® (autologous cultured chondrocytes on porcine collagen membrane) is an

autologous cellularized scaffold product indicated for the repair of single or multiple symptomatic, full-thickness cartilage defects of the knee with or without bone involvement in adults.

Limitations of Use

- Effectiveness of MACI in joints other than the knee has not been established.
- Safety and effectiveness of MACI in patients over the age of 55 years have not been established.

## 2 DOSAGE AND ADMINISTRATION

**For Autologous Implantation Only.**

Contact Vericel at 1-800-453-6948 or www.MACI.com regarding training materials for surgical implantation of MACI.

### 2.1 Dosage

- The amount of MACI implanted depends on the size (surface area in $cm^2$) of the cartilage defect. The surgeon should cut the MACI implant to the size and shape of the defect, to ensure the damaged area is completely covered.
- MACI implant is for single-use.
- Multiple implants may be used if there is more than one defect. The size of MACI is adjusted for the size of each cartilage defect.

### 2.2 Preparation and Implantation Procedure

**Collection of Autologous Cartilage Biopsy**

- The procedure may be performed arthroscopically.
- Using a ring curette or curved notchplasty gouge, harvest at least two (2) healthy full-thickness cartilage specimens from a lesser load-bearing area of the damaged knee, such as the lateral intercondylar notch, the superior lateral trochlear ridge, or the superior medial trochlear ridge.
- The specimens should measure approximately 5 x 8 mm each (200-300 mg total).
- The biopsy must be full-thickness and should include a small amount of subchondral bone, which will be removed prior to processing the biopsy.
- Some punctate bleeding may occur at the site of biopsy harvest.
- Using sterile technique, place the biopsy into transport medium bottle.

**Pre-Operative Preparation**

- Confirm that the patient’s identity matches the patient identifiers on the MACI labels.
- Inspect the sealed MACI shipping box for any evidence of damage.
- Open the MACI shipping box and inspect the internal packaging for leaks (liquid) in the outer bag or self-seal pouch containing the bottle holding the MACI implant or for any evidence of damage or contamination.
- DO NOT USE if the patient identifiers do not match, or there are signs of leaking or damage to the packaging. Contact MACI representative immediately or call Vericel Customer Care at 1-800-453-6948.
- After inspection, keep MACI in its original packaging and store at room temperature until the surgical site has been prepared.
- Arthroscopic delivery is for lesions that are a maximum of 4 $cm^2$ in size and are accessible using an arthroscopic approach.

**Implantation Procedure**

- Perform implantation procedure during arthrotomy or arthroscopy using sterile surgical techniques.
- Follow the implantation with an appropriate, physician-prescribed rehabilitation program *[see Dosage and Administration (2.3)].*
- NOTE:
  - The MACI Surgical Implantation Kit may be used to assist with MACI knee surgery via arthrotomy.
  - The MACI Arthroscopic Instruments may be used to assist with arthroscopic delivery.
  - Ensure instruments selected are appropriately matched to the defect size.

*Preparing Defect*

Arthroscopic Delivery:

- Create an appropriately placed portal to to visualize the defect to be treated athroscopically.
- Under direct arthroscopic vision insert a spinal needle directly over the center of the cartilage defect.
- Use the location determined by the spinal needle to create a second portal for the cannula (e.g., MACI Cannula Assembly) directly perpendicular to the defect.
- Measure the length and width of the defect using a measurement probe (e.g., measurement device) as shown in Figure 1.

**Figure 1: Measure defect size – Arthroscopic Method**

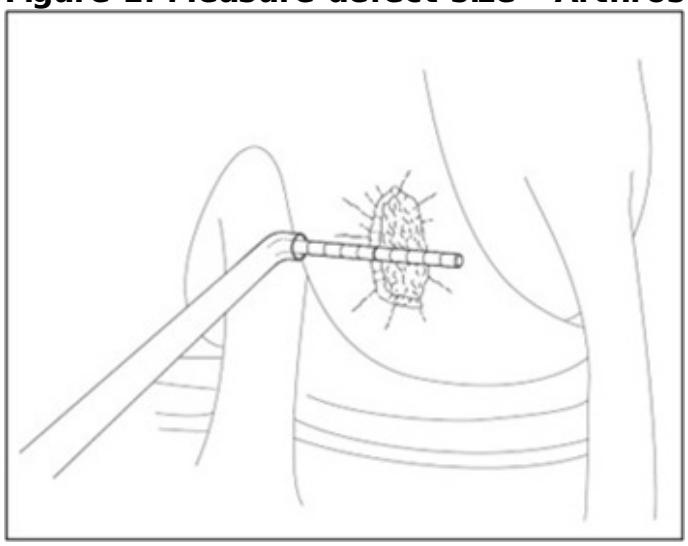

- Select and insert the appropriate size cannula (e.g., MACI Cannula Assembly) in this second portal directly over the center of the cartilage defect.
- Remove trocar from cannula assembly.
- Select the appropriate size cutter (e.g., MACI Arthroscopic Cutter) based on the defect size.
- Insert the cutter through the cannula and position over the cartilage defect. Adjust the angle of the cutter head, and apply pressure to score the cartilage surrounding the defect (Figure 2). Bring the cutter head back to its original position prior to removal from the joint.

**Figure 2: Score Cartilage – Arthroscopic Method**

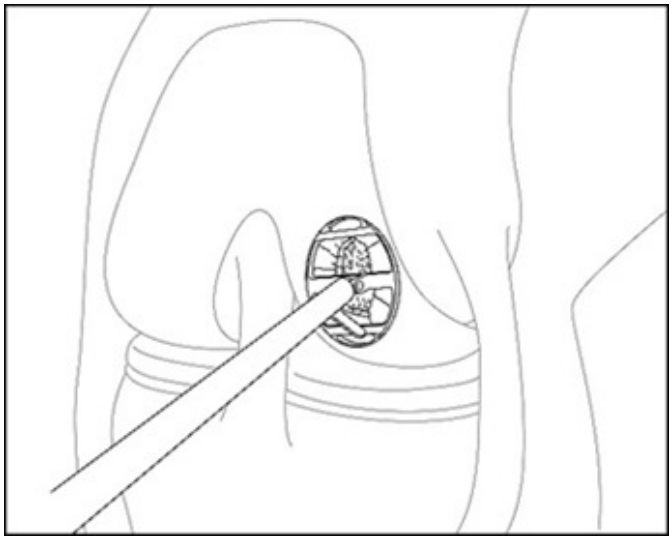

For Arthroscopic and Arthrotomy Delivery:

- For chondral defects, remove all damaged and fibrous tissue on the defect bed using appropriate instruments (e.g., MACI Rake Curette, MACI Square Curette and MACI Open-Ring Curette). Debride the defect bed back to stable cartilage with vertical walls down to the subchondral bone by removing as little healthy cartilage as possible (Figure 3). Do not penetrate the subchondral bone.

**Figure 3: Preparing Defect Bed**

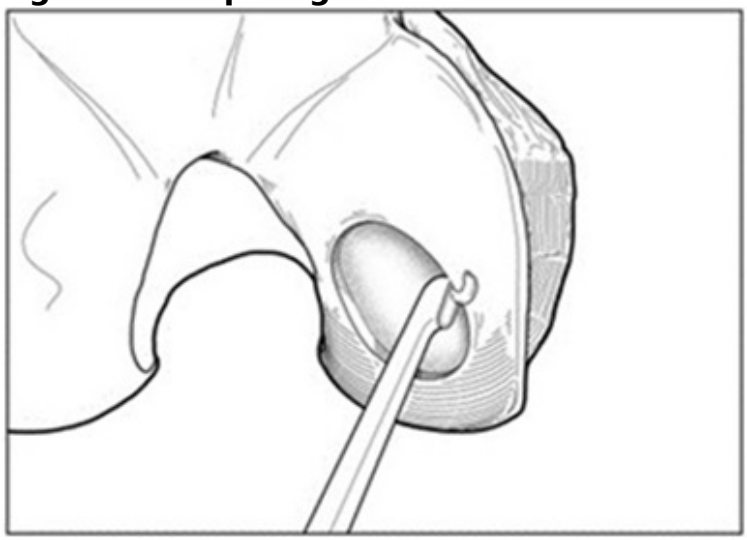

- For osteochondral defects, debride the defect bed back to stable cartilage with vertical walls down to healthy stable bone.
- Avoid bleeding through the subchondral plate. If bleeding occurs, use a suitable hemostatic agent to control the bleeding.

*Preparing MACI Implant*

- Unpacking MACI implant box (outside sterile field).
  - Unpack MACI implant shipping box.
  - Staff responsible for removing bottle from packaging and decanting contents into sterile container in sterile field should wear protective gown, gloves, and eyewear.
  - Remove the outer bag containing a bottle holding the MACI implant.
  - Remove the self-seal pouch containing the bottle from the outer bag (Figure 4).

**Figure 4: Bottle in Self-Sealed Pouch**

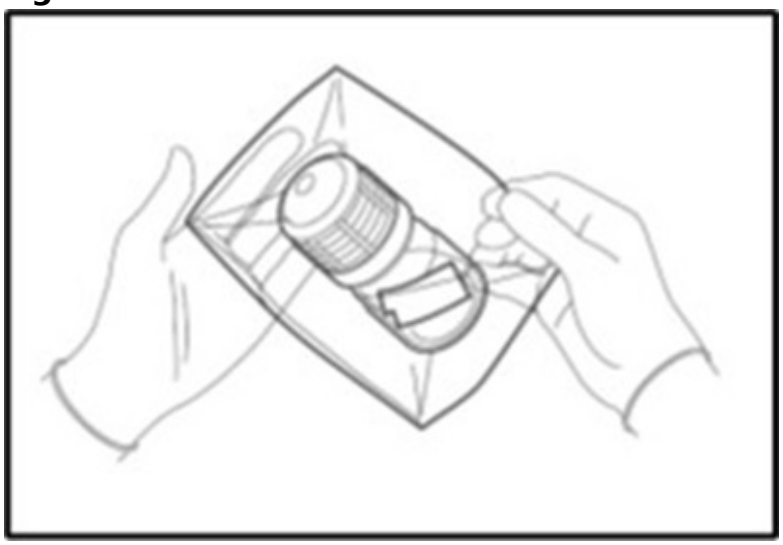

- Tear notches on the self-seal pouch to open the pouch and remove the bottle.
  Note: Keep the bottle upright and do not open the cap until ready to use the MACI implant.
  Note: Do not remove the MACI implant from the bottle until ready to be used.

- Unpacking the MACI implant bottle (Figure 5)
  - When ready, a team member outside the sterile field but adjacent to the sterile prep table, will twist open and remove the cap from the bottle. The outside of the bottle is not sterile, ensure that the MACI implant or sterile instruments do not come in contact with the outside of the bottle.
  - On sterile field, place sterile dish or container of sufficient size to hold contents of MACI implant bottle, approximately 120 mL of media.
  - Ensure MACI implant is free floating and not adhered to inner surface of bottle.

    Aseptically and rapidly decant the bottle contents into sterile dish including all transport media and the MACI implant.

    Note: If the MACI implant remains in the bottle, media from the sterile dish can be returned to the bottle via sterile syringe and decanted again. Alternatively, if the MACI has remained in the neck of the bottle, it can be extracted using sterile non-toothed forceps to grasp an edge or corner.

    **Figure 5: Unpacking MACI Implant**

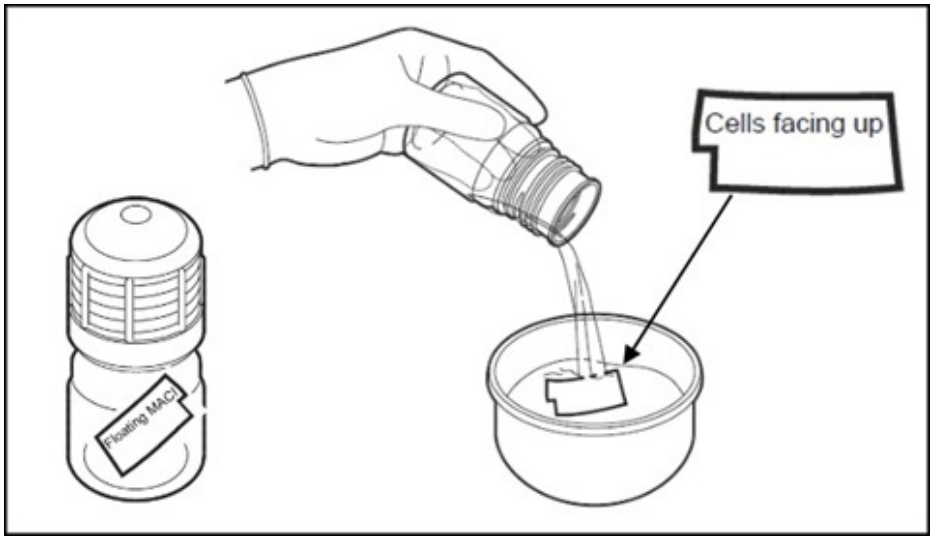


- The MACI implant has a rough side and a smooth side. The cells are seeded on the rough side. A notch in the lower left corner of the implant in landscape orientation indicates that the cell-side is facing up.
- The cell-side of the MACI implant should remain facing up at all times until placement into the defect. If the MACI implant is cell-side down after decanting from bottle, a sterile field team member will flip the membrane using two (2) sterile non-toothed forceps. The MACI implant should only be grasped by corners or edges.
- Sterile field team member will use two (2) sterile non-toothed forceps to grasp the MACI implant corners and place the MACI implant cell-side up onto a sterile work surface (e.g., MACI Cutting Block or MACI Arthroscopic Cutting Block). A notch in the lower left corner of the implant indicates that the cell-side is facing up.

Note: The MACI implant must remain hydrated with the shipping media. Use the decanted media from the sterile dish to maintain implant hydration after removal from the bottle.

*Shaping the MACI implant*

- Avoid excessive manipulation of the MACI implant. Throughout the shaping and delivery of the MACI implant it is important to keep track of membrane orientation to facilitate placing cells in the base of the defect.

Arthroscopic Delivery:

- Using the MACI Cutter that was packaged together with the Arthroscopic Cutter, place the MACI Cutter on top of the MACI implant and use light thumb pressure or lightly tap with a mallet to cut to size (Figure 6).

**Figure 6: Cut MACI Implant**

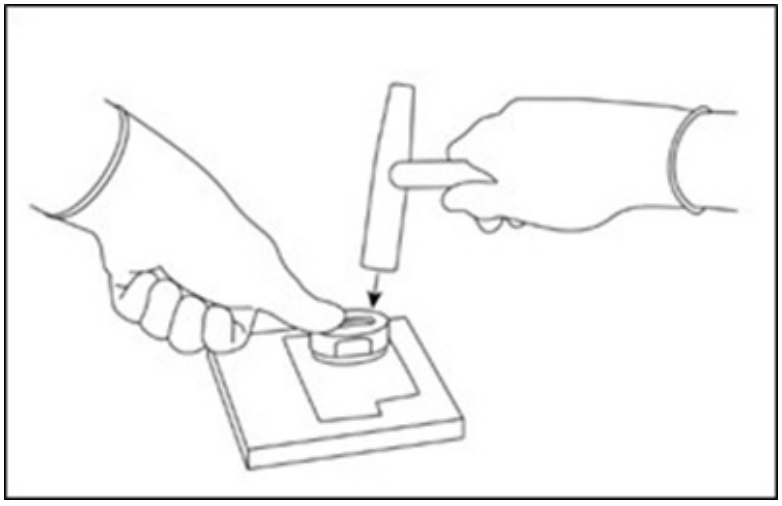

- Place any remaining MACI implant into a separate intermediary dish with adequate media to keep the implant hydrated.

Arthrotomy Delivery:

- Create an exact template of the defect (Figure 7).

**Figure 7: Creating Defect Template**

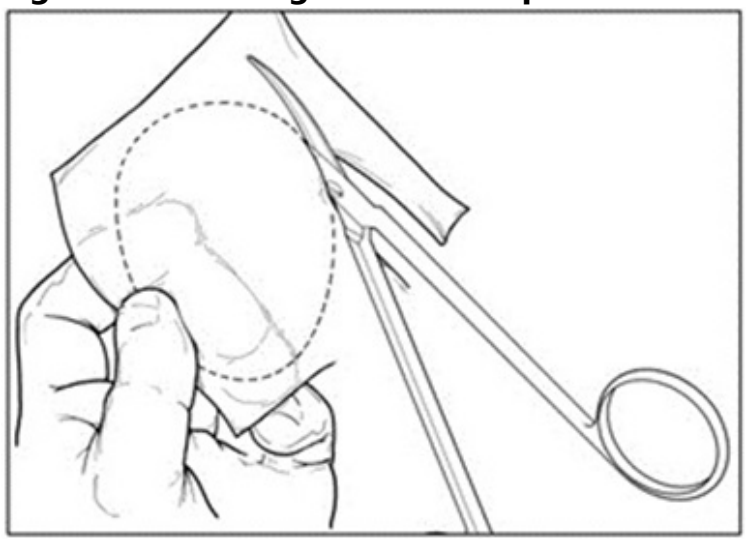

- Create orientation markers on the template to assist with proper orientation of the MACI implant. Turn the marked template over to ensure that the cells will be properly placed into the defect.
- To maintain proper orientation, turn the template over and place it underneath the MACI implant, against the smooth, non-seeded side. The template should be visible through the translucent implant.

  Note: Ensure minimal contact with the cell-seeded surface of the MACI implant.

- Using the template as a guide, cut the MACI implant to the correct size and shape.
- Place the custom-cut implant into a sterile intermediary dish, ensuring the cell-side up orientation. Ensure MACI implant remains hydrated at all times. Using sterile syringe, hydrate implant using decanted media.
- Place any remaining MACI implant into a separate intermediary dish with adequate media to keep the implant hydrated.

*Placing MACI Implant*

Arthroscopic Delivery

- Turn off fluid and drain the knee.
- If using a cannula with a dam (e.g., MACI Arthroscopic instrument), remove the dam from the cannula (Figure 8). Do not insert the MACI implant through a cannula dam.

**Figure 8: Remove Cannula Dam**

- A dry arthroscopic environment is essential for implantation. Remove any close liquid collections with the suction tip and ensure the defect area is dry and free of bleeding (e.g., using the spongy end of the MACI Applicator) (Figure 9).

**Figure 9: Dry Defect**

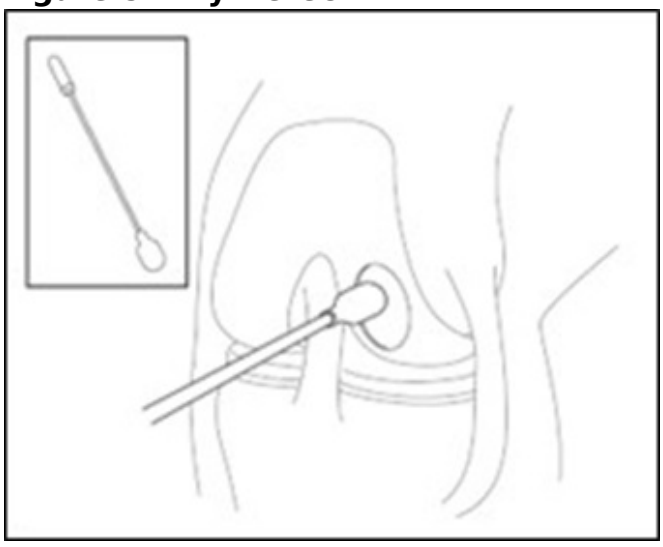

- Select appropriate size MACI V-Shuttle Delivery Device that matches the MACI Cannula diameter size used.
- Verify the V-Shuttle delivery device functionality by pressing the plunger to deploy the antennae prior to use.
- Gently place the MACI implant cell-side (rough side) up on the tip of the MACI V-Shuttle delivery device using forceps (Figure 10). Maintain the orientation of the V-Shuttle in an upright position.

**Figure 10: Placement on MACI V-Shuttle Delivery Device**

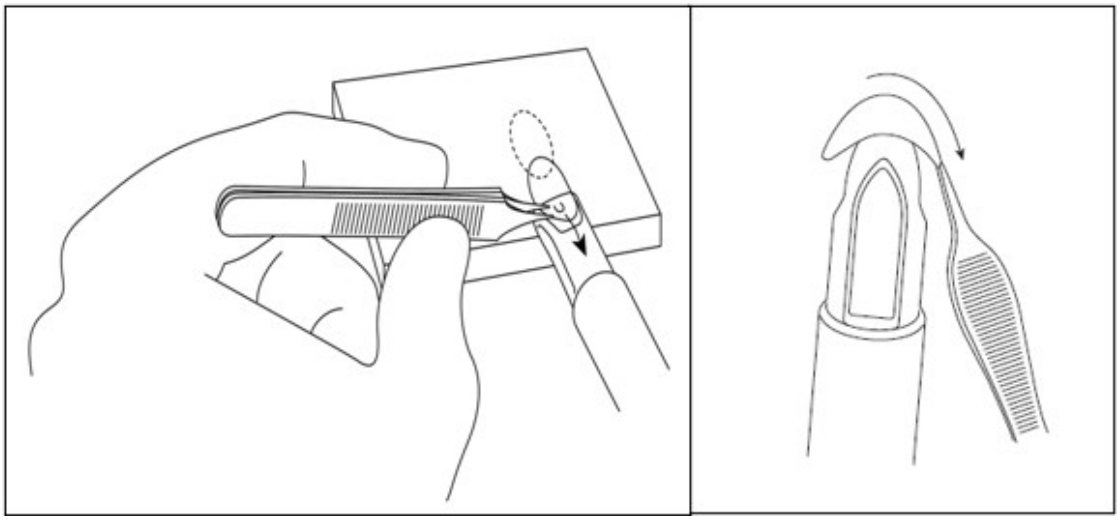

- Apply a thin layer of fibrin sealant to the entire base of the defect (bone) bed.
- Insert the MACI V-Shuttle with the loaded MACI implant into the MACI cannula ensuring the outer fins of the V Shuttle are oriented inferior and superior in line with the lesion. Slowly slide V-Shuttle through the cannula until the implant is positioned just over the defect.
- Once the MACI implant and MACI V-Shuttle are properly positioned directly over the center of the defect, gently push the plunger on the V-Shuttle to deploy the antennae to deliver the implant into the defect (Figure 11).

  Note: Do not compress the implant between the bone and the tip of the V-Shuttle. This may damage the cells on the MACI implant.

- Once the MACI implant is delivered into the defect, depress the plunger to retract the antennae and slowly retract the V-Shuttle from the cannula.

**Figure 11: Arthroscopic Delivery of MACI Implant to Defect**

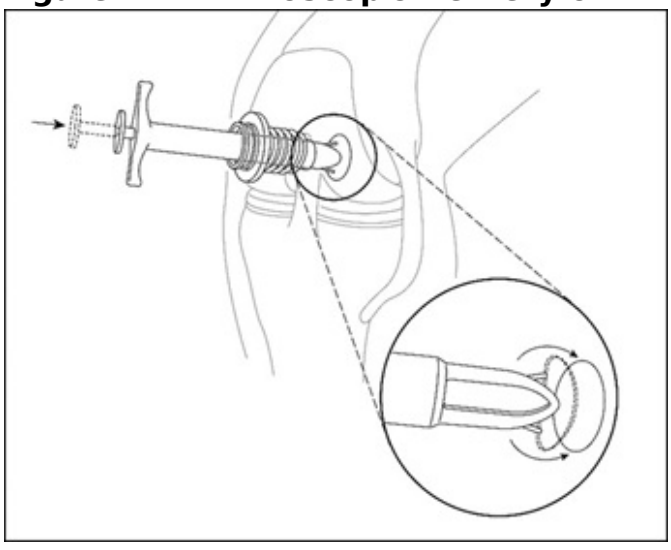

- Gently adjust placement of the MACI implant to desired location using a tamp (e.g., the silicone end of the MACI Applicator) and allow at least 3 minutes for the sealant to set (Figure 12).

**Figure 12: Placement of the MACI Implant**

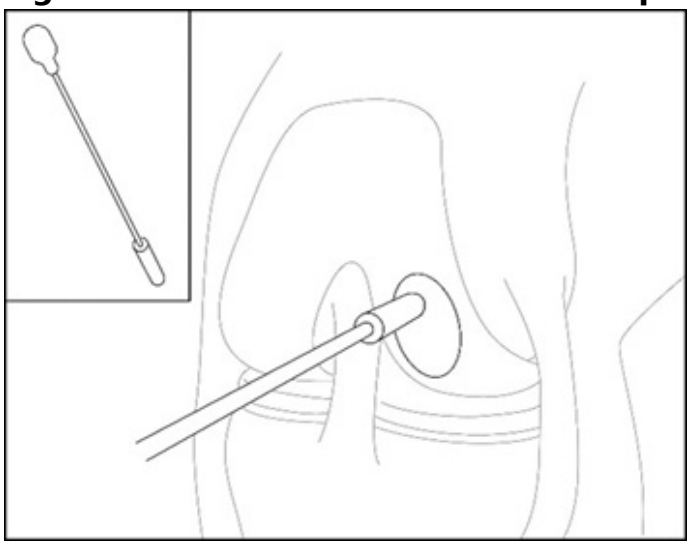

- Assess that the fibrin sealant has set and the MACI implant has adhered through the following methods: gently probing the implant with a blunt instrument (e.g. MACI Applicator), and repeated cycles of flexion and extenson of the knee.

Arthrotomy Delivery:

- Ensure defect area is dry and free of bleeding.
- Apply a thin layer of fibrin sealant to the entire base of the defect (bone) bed.
- Maintaining appropriate rotational orientation, place the custom-cut implant onto the defect bed cell-side down.
- Apply light digital pressure to the implant for approximately 3 minutes to allow sealant to set.
- Assess that the fibrin sealant has set and the MACI implant has adhered through the following methods: gently probing the implant with a blunt instrument (e.g. MACI Applicator), and repeated cycles of flexion and extension of the knee.
- MACI implant fixation may also be supplemented with interrupted resorbable sutures if desired or if conditions warrant, particularly if the defect is uncontained (i.e, the cartilage defect is not 100% surrounded by a stable cartilage rim) or the lesion is larger than 10 $cm^2$.

For Arthroscopic and Arthrotomy Delivery:

- Fibrin sealant may also be applied to the rim (periphery) of the implant.
- Discard unused MACI implant and media using bio-hazard hospital protocols.

### 2.3 Postsurgical Rehabilitation

A physician-prescribed rehabilitation program that includes early mobilization, joint range of motion, and weight bearing is recommended to promote graft maturation and reduce the risk of graft delamination, postoperative thromboembolic events, and joint stiffness. Stage this program to promote a progressive return to full joint range of motion and weight-bearing as well as muscle strengthening and conditioning. Return to recreational and sporting activity should be in consultation with healthcare professionals.

## 3 DOSAGE FORMS AND STRENGTHS

MACI implant is available as a cellular sheet, 3 x 5 cm, with a 0.5-$cm^2$ section removed from the lower left-hand corner, consisting of autologous cultured chondrocytes on a

resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$.

## 4 CONTRAINDICATIONS

MACI is contraindicated in patients with the following conditions:

- Known history of hypersensitivity to gentamicin, other aminoglycosides, or products of porcine or bovine origin. *[see Description (11)]*
- Severe osteoarthritis of the knee (Kellgren-Lawrence grade 3 or 4).
- Inflammatory arthritis, inflammatory joint disease, or uncorrected congenital blood coagulation disorders.
- Prior knee surgery (6 months), excluding surgery to procure a biopsy or a concomitant procedure to prepare the knee for a MACI implant.
- Inability to cooperate with a physician-prescribed post-surgical rehabilitation program *[See Dosage and Administration (2.3)].*

## 5 WARNINGS AND PRECAUTIONS

### 5.1 Malignancy

The safety of MACI used in patients with malignancy in the area of cartilage biopsy or implant is unknown. The potential exists for expansion of malignant or dysplastic cells present in biopsy tissue during manufacture and subsequent implantation. In addition, implantation of normal autologous chondrocytes could theoretically stimulate growth of malignant cells in the area of the implant, although there have been no such incidents reported in humans or animals.

### 5.2 Transmissible Infectious Diseases

MACI is intended solely for autologous use. Patients undergoing the surgical procedures associated with MACI are not routinely tested for transmissible infectious diseases. Therefore, the cartilage biopsy and the MACI implant may carry the risk of transmitting infectious diseases to personnel handling these tissues. Accordingly, healthcare providers should employ universal precautions in handling the biopsy samples and the MACI product.

Product manufacture includes reagents derived from animal materials. All animal-derived reagents are tested for viruses, retroviruses, bacteria, fungi, yeast, and mycoplasma before use. Bovine materials are sourced to minimize the risk of transmitting a prion protein that causes bovine spongiform encephalopathy and may cause a rare fatal condition in humans called variant Creutzfeldt-Jakob disease.

These measures do not totally eliminate the risk of transmitting these or other transmissible infectious diseases and disease agents. Report the occurrence of a transmitted infection to Vericel Corporation at 1-800-453-6948.

### 5.3 Presurgical Assessment of Comorbidities

To create a favorable environment for healing, assess and treat the following conditions prior to or concurrent with implantation with MACI:

- Local inflammation or active infection in the bone, joint, and surrounding soft tissue: patients should be deferred until complete recovery.
- Meniscal pathology: presence of an unstable or torn meniscus requires partial resection, repair, or replacement prior to or concurrent with MACI implantation. MACI is not recommended in patients with a total meniscectomy.

- Cruciate ligament instability: the joint should not possess excessive laxity, which may create excessive shear and rotational forces across the joint. Both anterior and posterior cruciate ligaments should be stable or undergo reconstruction prior to or concurrent with MACI implantation.
- Misalignment: the tibio-femoral joint should be properly aligned, and patella tracking should be normalized. Varus or valgus misalignment of the tibio-femoral joint and abnormal patella tracking may abnormally load joint surfaces and jeopardize the implant. Misalignment and patella tracking should be addressed with a corrective osteotomy or similar corrective procedure prior to or concurrent with MACI implantation.

### 5.4 Product Sterility

MACI is shipped after passing preliminary test results from in-process microbial tests. A final sterility test is initiated prior to shipping, but the result will not be available prior to implantation. If microbial contamination is detected after the product has been shipped, Vericel will notify the healthcare provider(s) and recommend appropriate actions.

## 6 ADVERSE REACTIONS

The most frequently occurring adverse reactions (≥5%) reported for MACI were arthralgia, tendonitis, back pain, joint swelling, and joint effusion.

Serious adverse reactions reported for MACI were arthralgia, cartilage injury, meniscus injury, treatment failure, and osteoarthritis.

### 6.1 Clinical Trials Experience

Because clinical trials are conducted under widely varying conditions, adverse reaction rates observed in the clinical trials of a product cannot be directly compared to rates in the clinical trials of another product and may not reflect the rates observed in practice.

In a 2-year prospective, multicenter, randomized, open-label, parallel-group clinical trial, 144 patients, ages 18 to 54 years, were randomized to receive a 1-time treatment with MACI or microfracture (1:1, 72 patients in each treatment group). Demographic characteristics of patients in the trial were similar in both treatment groups. The majority of patients were male (62.5% MACI, 66.7% microfracture), and the mean ages were 34.8 (MACI) and 32.9 (microfracture) years. Overall, 70 patients in the MACI group and 67 patients in the microfracture group completed 2 years of follow-up.

In addition, all 144 subjects from the 2-year clinical trial had the option to enroll in a 3-year follow-up study (extension study). Safety and efficacy assessments were performed at yearly scheduled visits. The demographic characteristics of patients (N = 128) enrolled in the extension study were similar in both treatment groups and consistent with the overall population of the 2-year clinical trial.

The proportion of patients with at least one (1) subsequent surgical procedure (any surgical procedure performed on the treated knee joint, including arthroscopy, arthrotomy, or manipulation under anesthesia) in the 2 years following study treatment was comparable between treatment groups (8.3% in the MACI group and 9.7% in the microfracture group).

Adverse reactions reported in ≥5% of patients in either treatment group in the 2-year clinical trial are provided in Table 1.

**Table 1. Adverse Reactions in ≥5% of Patients in Any Treatment Group in the 2-Year Clinical Trial**

| System Organ Class | MACI n = 72 n (%) | Microfracture n = 72 n (%) |
|---|---|---|
| **Musculoskeletal and Connective Tissue Disorders** | | |
| Arthralgia | 37 (51.4) | 46 (63.9) |
| Back pain | 8 (11.1) | 7 (9.7) |
| Joint swelling | 7 (9.7) | 4 (5.6) |
| Joint effusion | 5 (6.9) | 4 (5.6) |
| **Injury, Poisoning and Procedural Complications** | | |
| Cartilage injury | 3 (4.2) | 9 (12.5) |
| Ligament sprain | 3 (4.2) | 5 (6.9) |
| Procedural pain | 3 (4.2) | 4 (5.6) |
| **General Disorders and Administration Site Conditions** | | |
| Treatment failure | 1 (1.4) | 4 (5.6) |

In the 3-year extension study, adverse reactions reported in ≥5% of patients were (MACI vs microfracture): arthralgia (46.2% vs 50.8%), tendonitis (6.2% vs 1.6%), back pain (4.6% vs 6.3%), osteoarthritis (4.6% vs 7.9%), joint effusion (3.1% vs 7.9%), cartilage injury (6.2% vs 15.9%), procedural pain (3.1% vs 7.9%), ligament sprain (1.5% vs 7.9%), and treatment failure (4.6% vs 7.9%).

Serious adverse reactions reported in patients in either treatment group for integrated data across the 2-year clinical trial and the 3-year extension study are provided in Table 2.

**Table 2. Serious Adverse Reactions in Patients in Any Treatment Group Across the 2-Year Clinical Trial and the 3-Year Extension Study**

| System Organ Class | MACI n = 72 n (%) | Microfracture n = 72 n (%) |
|---|---|---|
| **Musculoskeletal and Connective Tissue Disorders** | | |
| Arthralgia | 1 (1.4) | 7 (9.7) |
| Back pain | 0 | 3 (4.2) |
| Joint swelling | 3 (4.2) | 0 |
| Joint effusion | 3 (4.2) | 0 |
| **Injury, Poisoning and Procedural Complications** | | |
| Cartilage injury | 3 (4.2) | 8 (11.1) |
| **General Disorders and Administration Site Conditions** | | |
| Treatment failure | 3 (4.2) | 7 (9.7) |

### 6.2 Postmarketing Experience

Graft complication (e.g., abnormalities to the repair graft that become symptomatic; this could include graft overgrowth [tissue hypertrophy], under-fill or damage to the repair tissue that has elicited a painful response, or mechanical symptoms), graft delamination (i.e., a dislodging of the repair graft from the underlying subchondral bone that has become symptomatic; this can be measured as marginal, partial, or a complete delaminated graft), and tendonitis have been reported during use of MACI outside the United States. Because these reactions are reported voluntarily from a population of uncertain size, it is not always possible to reliably estimate their frequency or establish a causal relationship to MACI exposure.

## 8 USE IN SPECIFIC POPULATIONS

### 8.1 Pregnancy

Risk Summary

MACI implantation requires invasive surgical procedures; therefore use during pregnancy is not recommended. Limited clinical data on patients exposed to MACI during pregnancy are available. There are insufficient data with MACI use in pregnant women to inform a product-associated risk. Animal reproduction studies have not been conducted with MACI. In the U.S. general population, the estimated background risk of major birth defects and miscarriage in clinically recognized pregnancies is 2-4% and 15-20%, respectively.

### 8.2 Lactation

Risk Summary

There is no information regarding the presence of MACI in human milk, the effects on the breastfed infant, or the effects on milk production. The developmental and health benefits of breastfeeding should be considered along with the mother’s clinical need for MACI and any potential adverse effects on the breastfed infant from MACI or from the underlying maternal condition.

### 8.4 Pediatric Use

The safety and effectiveness of MACI in pediatric patients have not been established.

### 8.5 Geriatric Use

The safety and effectiveness of MACI in patients over 65 years of age have not been established. Clinical trials of MACI did not include subjects over the age of 55.

## 11 DESCRIPTION

MACI, autologous cultured chondrocytes on porcine collagen membrane, is a cellular sheet that consists of autologous chondrocytes seeded on a 3 x 5 cm, resorbable porcine Type I/III collagen membrane, for implantation into cartilage defects of the knee. The active ingredients of MACI are the autologous cultured chondrocytes and porcine Type I/III collagen. The autologous chondrocytes are propagated in cell culture and are seeded on the collagen at a density of 500,000 to 1,000,000 cells per $cm^2$. The final MACI implant contains at least 500,000 cells per $cm^2$ and does not contain any preservative.

The product manufacture also uses reagents derived from animal materials. The

resorbable, Type I/III, collagen membrane, which is a component of MACI, is porcine-derived. Fetal bovine serum is a component in the culture medium used to propagate the autologous chondrocytes; therefore, trace quantities of bovine-derived proteins may be present in MACI. These animal-derived reagents are tested for viruses, retroviruses, bacteria, fungi, yeast, and mycoplasma before use.

MACI may contain residual gentamicin because it is included during manufacture. Gentamicin is not included in the transport medium used to maintain product stability. Studies determined an average of 9.2 µg residual gentamicin per MACI implant.

A final sterility test is initiated prior to shipping, but the result will not be available prior to implantation. Passing results from preliminary in-process microbial tests are required for release of MACI for shipping.

## 12 CLINICAL PHARMACOLOGY

### 12.1 Mechanism of Action

No clinical pharmacology studies have been conducted with MACI and a mechanism of action has not been established.

### 12.3 Pharmacokinetics

Clinical pharmacokinetic studies have not been performed with MACI. Studies in rabbits and horses indicated that the membrane is resorbed over a period of at least 6 months following implantation.

## 13 NONCLINICAL TOXICOLOGY

### 13.1 Carcinogenesis, Mutagenesis, Impairment of Fertility

Studies to evaluate the carcinogenicity or impairment of fertility potential of MACI have not been performed. In vitro studies have shown that the expansion process for chondrocytes does not induce changes to the cellular karyotype.

Four studies (*in vitro* and *in vivo*) were conducted to assess the genotoxic potential of the collagen membrane. The results from these studies demonstrated that the collagen membrane was non-mutagenic.

### 13.2 Animal Toxicology and/or Pharmacology

Implantation of analogous products in critical-size defects in the hind limbs of rabbits and horses did not reveal any serious safety concerns. The products consisted of the same membrane as MACI with rabbit or horse cells, respectively. Non-clinical testing has shown that the collagen membrane is not toxic and is compatible with biological tissue.

## 14 CLINICAL STUDIES

The effectiveness of MACI implant was evaluated in a 2-year prospective, multicenter, randomized, open-label, parallel-group study, SUMMIT (Superiority of MACI implant versus Microfracture Treatment in patients with symptomatic articular cartilage defects in the knee), which enrolled a total of 144 subjects, ages 18 to 54 years, with at least one symptomatic Outerbridge Grade III or IV focal cartilage defect on the medial femoral condyle, lateral femoral condyle, and/or the trochlea. Failure of a prior cartilage surgery

was not required for study entry. The subjects were randomized to receive either a 1-time treatment with MACI or microfracture. The co-primary efficacy endpoint was change from baseline to Week 104 for the subject's Knee injury and Osteoarthritis Outcome Score (KOOS) in two subscales: Pain and Function (Sports and Recreational Activities [SRA])[1]. Safety also was evaluated through Week 104 *[see Adverse Reactions (6.1)].*

Of the 72 subjects randomized to MACI, 70 completed the study and two (2) discontinued prematurely (one (1) due to an adverse event [AE] and one (1) wished to withdraw). Of the 72 subjects randomized to microfracture, 67 completed the study and five (5) discontinued prematurely (one (1) due to an AE, one (1) wished to withdraw, and three (3) due to lack of clinical benefit).

At Week 104, KOOS pain and function (SRA) had improved from baseline in both treatment groups, but the improvement was statistically significantly (p = 0.001) greater in the MACI group compared with the microfracture group (Table 3).

**Table 3. Change in KOOS Pain and Function (SRA) Scores in the 2-Year Study**

| | **MACI Mean (SD)** | | | **Microfracture Mean (SD)** | | |
|---|---|---|---|---|---|---|
| | **N** | **Pain** | **Function** | **N** | **Pain** | **Function** |
| Baseline | 72 | 37.0 (13.5) | 14.9 (14.7) | 71 | 35.4 (12.1) | 12.6 (16.7) |
| Week 104 | 72 | 82.4 (16.2) | 60.9 (27.8) | 70 | 70.9 (24.2) | 48.7 (30.3) |
| Change From Baseline to Week 104 | 72 | 45.4 (21.1) | 46.0 (28.4) | 69 | 35.2 (23.9) | 35.8 (31.6) |
| LS Means (Week 104) | | 44.1 | 46.1 | | 32.4 | 34.6 |
| **Difference * [MACI – Microfracture]** | | 11.8 | 11.4 | | | |
| **p-value †** | 0.001 | | | | | |

LS = least squares; KOOS = Knee injury and Osteoarthritis Outcome Score; SD = standard deviation; SRA = Sports and Recreational Activities.

* Difference in least squares mean values at Week 104 [MACI – Microfracture].

† p-value for difference in co-primary endpoints assessed jointly at Week 104 based on multivariate analysis of variance.

In a responder analysis, the proportion of subjects with at least a 10-point improvement in both KOOS pain and function (SRA) was greater in the MACI group (63/72=87.5%; 95% CI [77.6%, 94.1%]) compared with the microfracture group (49/72=68.1%; 95% CI [56.0%, 78.6%]).

All subjects from the 2-year study had the option to enroll in a 3-year follow-up study (extension study), in which 128 subjects participated. All 65 subjects (100%, 65/65) in the MACI group and 59 subjects (93.7%, 59/63) in the microfracture group completed the extension study. The mean 2-year KOOS pain and function scores remained stable for the additional 3-year period in both treatment groups (Table 4).

**Table 4. KOOS Pain and Function (SRA) Scores in the 3-Year Extension Study**

| **Visit** | **MACI** | | | **Microfracture** | | |
|---|---|---|---|---|---|---|
| | **N** | **Pain mean (SD)** | **Function mean (SD)** | **N** | **Pain mean (SD)** | **Function mean (SD)** |
| Baseline | 65/65 | 37.1 (13.1) | 15.4 (14.8) | 63/63 | 35.2 (12.3) | 11.9 (16.2) |

| | | | | | | |
|---|---|---|---|---|---|---|
| 2 Years | 63/63 | 82.2 (15.8) | 60.5 (26.5) | 60/60 | 71.8 (23.9) | 48.9 (30.6) |
| 5 Years | 65/64 | 82.2 (20.1) | 61.9 (30.9) | 59/59 | 74.8 (21.7) | 50.3 (32.3) |

## 15 REFERENCES

1. Roos EM, Lohmander LS. The Knee injury and Osteoarthritis Outcome Score (KOOS): from joint injury to osteoarthritis. Health Qual Life Outcomes. 2003;1:64.

## 16 HOW SUPPLIED/STORAGE AND HANDLING

How Supplied

- A single patient order may contain one (1) or two (2) implants, each in its own bottle and shipper, depending on lesion size and number of lesions.

  *MACI - One (1) Implant*

- MACI, NDC69866-1030-5 (outer box), contains one (1) implant supplied ready for use as a single cellular sheet approximately 3 x 5 cm, in a sterile, sealed, translucent perfluoroalkoxy (PFA) resin bottle and cap. Each bottle contains one 3 x 5 cm implant with a 0.5-$cm^2$ section removed from the lower left-hand corner.

  *MACI - Two (2) Implant*

- MACI, NDC69866-1030-8 (outer box), contains two (2) implants supplied ready for use as cellular sheets approximately 3 x 5 cm, in a sterile, sealed, translucent perfluoroalkoxy (PFA) resin bottle and cap. Each bottle contains one 3 x 5 cm implant with a 0.5 $cm^2$ section removed from the lower left-hand corner.
- Each bottle is individually sealed in a clear self-seal pouch. Each self-seal pouch is placed into a 95kPa outer bag with absorbent material. These bags are enclosed in an outer box insulated with ambient temperature gel packs.

Storage and Handling

- Store MACI at room temperature in its original packaging (outer box) until ready to use.
- DO NOT REFRIGERATE or FREEZE, or sterilize MACI.
- DO NOT USE if the bottle is damaged, has been compromised, or has leaked.
- Use MACI prior to 11:59 PM EST on the date of expiration printed on the package.
- Dispose of unused MACI or waste material as surgical biohazardous waste in accordance with local requirements.

## 17 PATIENT COUNSELING INFORMATION

- Advise the patient that:
  - A cartilage biopsy is needed to manufacture MACI. The biopsy is typically performed as an arthroscopic procedure at the time of diagnosis confirmation.
  - The length of time between the biopsy and the implantation of MACI may vary depending on many factors, including the quality and number of cells obtained from the biopsy. Cells can be held in storage until a convenient date for surgery is agreed upon between the patient and the surgeon.
  - Even if the surgeon has taken a biopsy needed to produce MACI, it may be possible that the patient cannot be treated with MACI, (e.g., in case the biopsy is of insufficient quality to produce MACI, if the cells cannot be grown in the

laboratory, or if the expanded cells do not meet all the quality requirements).

- Advise the patient on the risk of graft complications, subsequent surgical procedures, and treatment failure. *[See Adverse Reactions (6)]*
- Advise the patient on general complications related to knee surgery, which may include deep vein thrombosis and pulmonary embolism.
- Advise the patient to closely follow the physician-prescribed rehabilitation program, which will include limitations and allowances for beginning specific physical activities. *[See Dosage and Administration (2.3)]*
- Inform patient about the possible risk of transmission of infectious diseases with MACI implantation. *[See Warnings and Precautions (5.2)]*

Manufactured by: Vericel Corporation, 64 Sidney Street, Cambridge, MA 02139
MACI® is a registered trademark of Vericel Corporation.
Patents: www.vcel.com/research-and-development
© 2025 Vericel Corporation.
65628 Revision 4
09/2025

Manufactured by: Vericel Corporation, 25 Blue Sky Drive, Burlington, MA 01803
MACI® is a registered trademark of Vericel Corporation.
Patents: www.vcel.com/research-and-development
© 2026 Vericel Corporation.
65655 Revision 1
03/2026

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-3 - Bottle Label**

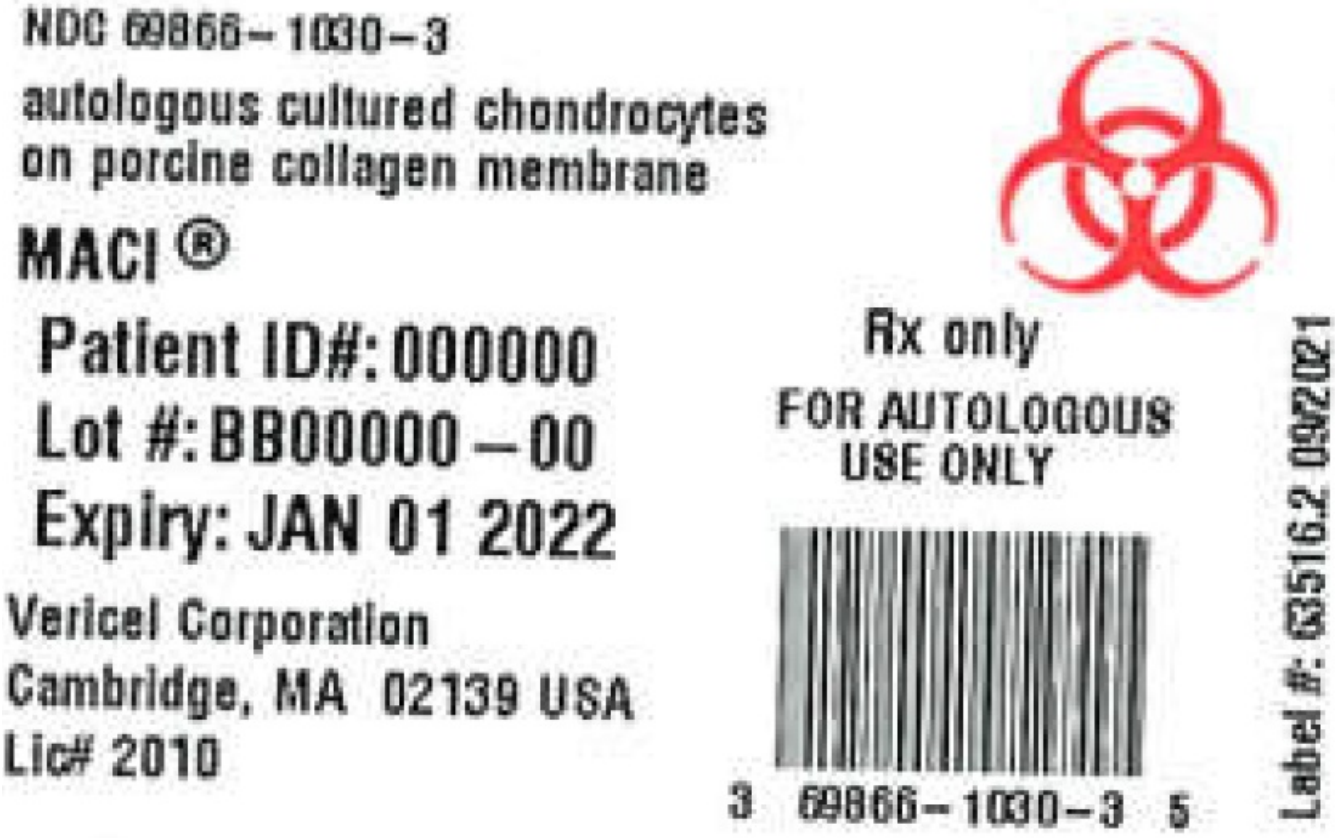

NDC 69866-1030-3

autologous cultured chondrocytes on porcine collagen membrane

**MACI®**

Patient ID#: %PATIENT_ID%

Lot #: %BATCH%

Expiry: %EXPIRY%

Vericel Corporation
Burlington, MA 01803 USA
Lic# 2010

Rx only
FOR AUTOLOGOUS USE ONLY

3 69866-1030-3 5

Label #: 63546.1 062025

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-4 - Outer Pouch Label**

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-4

**Rx Only**

# MACI®

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_NAME%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains (1 of 1) MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

3 69866-1030-4 2

Label # 64579.4 - 03/2023

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-4

# MACI®

**Rx Only**

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_NAME%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains (1 of 1) MACI implant approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA
Lic. #: 2010

Label # 64648.1 - 06/2025

3 69866-1030-4 2

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-5 - Shipper Label**

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-5

# MACI®

**Rx Only**

Label # 64584.5 - 09/2024

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_INITIALS%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains one MACI implant approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

GTIN: 00369866103059
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-5 9

MACI® is a registered trademark of Vericel Corporation.

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-5

# MACI®

**Rx Only**

Label # 64650.1 - 06/2025

**FOR AUTOLOGOUS USE ONLY**
NOT EVALUATED FOR INFECTIOUS SUBSTANCES
No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**
Patient ID #: %PATIENT_ID%
%PAT_INITIALS%
Lot #: %BATCH%
Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains one MACI implant approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA
Lic. #: 2010

MACI® is a registered trademark of Vericel Corporation.

GTIN 00369866000006
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-5 9

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-6 - Bottle Label**

NDC 69866 – 1030 – 6 **Membrane1**
autologous cultured chondrocytes
on porcine collagen membrane
**MACI ®**
Patient ID#: 123456
Lot #: BB12345 – 21
Expiry: MAY 26 2023
Vericel Corporation
Cambridge, MA 02139 USA
Lic# 2010

Rx only
FOR AUTOLOGOUS USE ONLY

3 69866 – 1030 – 6 6

Label #: 63517.3 07/2023

NDC 69866 – 1030 – 6 **Membrane2**
autologous cultured chondrocytes
on porcine collagen membrane
**MACI ®**
Patient ID#: 123456
Lot #: BB12345 – 21
Expiry: MAY 26 2023
Vericel Corporation
Cambridge, MA 02139 USA
Lic# 2010

Rx only
FOR AUTOLOGOUS USE ONLY

3 69866 – 1030 – 6 6

Label #: 63517.3 07/2023

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-7 - Outer Pouch Label**

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-7

# MACI®

**Rx Only**

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_NAME%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains (2 of 2) MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

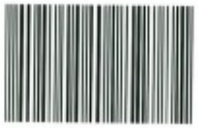

3 69866-1030-7 3

Label # 64580.4 - 03/2023

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-7

# MACI®

**Rx Only**

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_NAME%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains (1 of 2) MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

Label # 64580.4 - 03/2023

3 69866-1030-7 3

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-7

**Rx Only**

# MACI®

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**Hospital**

Patient ID #: 123456

Test Print

Lot #: BB12345-21

Expiration: Jan 01 2025

**Store at Room Temperature. DO NOT FREEZE**

This package contains (1 of 2) MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA
Lic. #: 2010

Label # 64649.1 - 06/2025

3 69866-1030-7 3

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-7

**Rx Only**

MACI®

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**Hospital**

Patient ID #: 123456

Test Print

Lot #: BB12345-21

Expiration: Jan 01 2025

**Store at Room Temperature. DO NOT FREEZE**

This package contains (2 of 2) MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membrane at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA

Lic. #: 2010

Label # 64649.1 - 06/2025

3 69866-1030-7 3

**PRINCIPAL DISPLAY PANEL - NDC: 69866-1030-8 - Shipper Label**

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-8

# MACI®

**Rx Only**

Label # 64583.5 - 09/2024

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_INITIALS%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains two MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membranes at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

GTIN: 00369866103080
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-8 0

MACI® is a registered trademark of Vericel Corporation.

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-8

MACI®

Rx Only

Label # 64583.5 - 09/2024

FOR AUTOLOGOUS USE ONLY

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

%HOSPITAL%

Patient ID #: %PATIENT_ID%

%PAT_INITIALS%

Lot #: %BATCH%

Expiration: %EXPIRY%

Store at Room Temperature. DO NOT FREEZE

This package contains two MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membranes at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Cambridge, MA 02139 USA
Lic. #: 2010

MACI® is a registered trademark of Vericel Corporation.

GTIN: 00369866103080
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-8 0

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-8

**Rx Only**

Label # 64651.1 - 05/2025

# MACI®

**FOR AUTOLOGOUS USE ONLY**

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

**%HOSPITAL%**

Patient ID #: %PATIENT_ID%

%PAT_INITIALS%

Lot #: %BATCH%

Expiration: %EXPIRY%

**Store at Room Temperature. DO NOT FREEZE**

This package contains two MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membranes at a density of at least 500,000 cells per $cm^2$

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA
Lic. #: 2010

GTIN: 00389886000037
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-8 0

MACI® is a registered trademark of Vericel Corporation.

autologous cultured chondrocytes
on porcine collagen membrane

NDC 69866-1030-8

Rx Only

Label # 64651.1 - 05/2025

MACI®

FOR AUTOLOGOUS USE ONLY

NOT EVALUATED FOR INFECTIOUS SUBSTANCES

No preservatives. Do not use in patients with known allergies to gentamicin, other aminoglycosides, or products of porcine or bovine origin.

%HOSPITAL%

Patient ID #: %PATIENT_ID%

%PAT_INITIALS%

Lot #: %BATCH%

Expiration: %EXPIRY%

Store at Room Temperature. DO NOT FREEZE

This package contains two MACI implants approximately 3 x 5 cm, consisting of autologous cultured chondrocytes on a resorbable Type I/III collagen membranes at a density of at least 500,000 cells per cm²

See package insert for full prescribing information and instructions for administration

Vericel Corporation
Burlington, MA 01803 USA
Lic. #: 2010

MACI® is a registered trademark of Vericel Corporation.

GTIN: 00380886000037
SN: %SERIAL%
EXP: %EXPIRY2%
LOT: %BATCH%

3 69866-1030-8 0

# MACI

autologous cultured chondrocytes implant

| Product Information | | | |
|---|---|---|---|
| **Product Type** | CELLULAR THERAPY | **Item Code (Source)** | NDC:69866-1030 |
| **Route of Administration** | INTRA-ARTICULAR | | |

| Active Ingredient/Active Moiety | | |
|---|---|---|
| **Ingredient Name** | **Basis of Strength** | **Strength** |
| **AUTOLOGOUS CULTURED CHONDROCYTES** (UNII: D5P3K3V822) (AUTOLOGOUS CULTURED CHONDROCYTES - UNII:D5P3K3V822) | AUTOLOGOUS CULTURED CHONDROCYTES | 15000000 |
| **PORK COLLAGEN** (UNII: I8442U2G7J) (PORK COLLAGEN - UNII:I8442U2G7J) | PORK COLLAGEN | 15 cm2 |

**Packaging**

| # | Item Code | Package Description | Marketing Start Date | Marketing End Date |
|---|---|---|---|---|
| **1** | NDC:69866-1030-5 | 1 in 1 BOX | | |
| **1** | NDC:69866-1030-4 | 1 in 1 BAG | | |
| **1** | NDC:69866-1030-3 | 1 in 1 BOTTLE, PLASTIC; Type 5: Device Coated or Otherwise Combined with Biologic | | |
| **2** | NDC:69866-1030-8 | 2 in 1 BOX | | |
| **2** | NDC:69866-1030-7 | 1 in 1 BAG | | |
| **2** | NDC:69866-1030-6 | 1 in 1 BOTTLE, PLASTIC; Type 5: Device Coated or Otherwise Combined with Biologic | | |

## Marketing Information

| Marketing Category | Application Number or Monograph Citation | Marketing Start Date | Marketing End Date |
|---|---|---|---|
| BLA | BLA125603 | 06/09/2017 | |

**Labeler -** Vericel Corporation (079745570)

| Establishment | | | |
|---|---|---|---|
| **Name** | **Address** | **ID/FEI** | **Business Operations** |
| Vericel Corporation | | 119545111 | analysis, api manufacture, manufacture(69866-1030) , pack(69866-1030) , label(69866-1030) |

Revised: 3/2026

Vericel Corporation